



Installation instructions of 4.3/10 type male connector for 1/2" superflexible cable

43M-SCF12-CP01

ITEM: 2161230.1


Please read the instructions carefully before assembly.

Tools and Material:

Trimming tool, compression gun, power drill, spacer 4, cable cutter, foam remover.



Assembly tools (required).

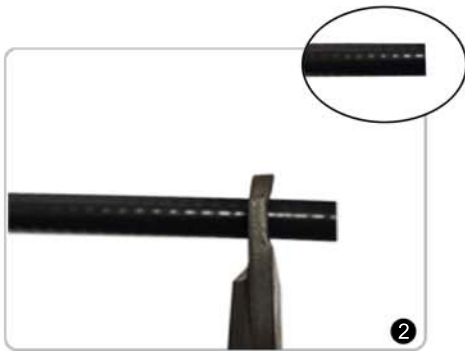


Straighten cable.
Cut off the cable head.





Attach the trimming tool to power drill.



Insert the cable into the trimming tool.
Select the low speed on the drill or 400~600 RPM on a variable speed drill. Trim the cable until no further debris generated.

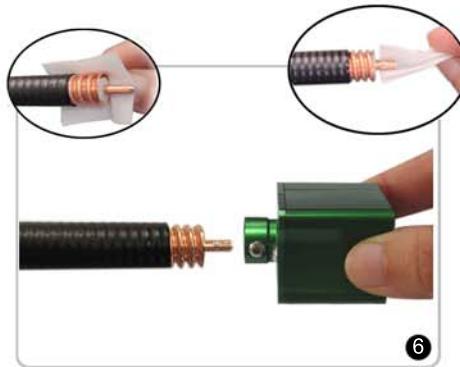

Use foam remover to remove any dielectric residue from the inner conductor. Clean the inner and outer conductor with alcohol pad.

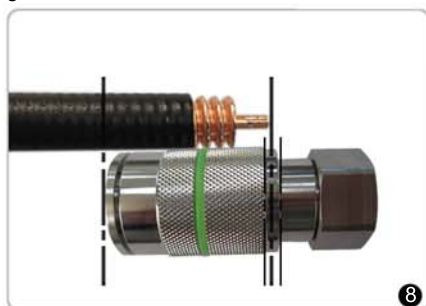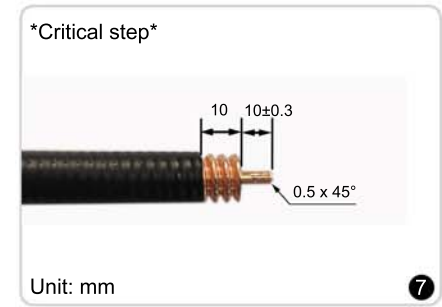

Align inner conductor as shown with the middle of two lines. Mark cable jacket in line with end of connector.




Screw the connector onto the cable until it reaches the marked line. Over tighten is forbidden.



Installation instructions of 4.3/10 screw type male connector for 1/2" superflexible cable

43M-SCF12-CP01

ITEM: 2161230.1

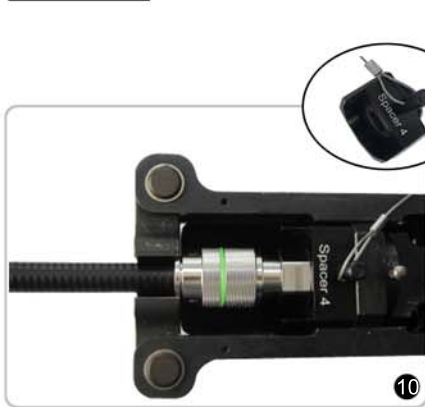

Place spacer 4 into the compression frame. Make sure the connector and cable both lay flat in the compression frame.



Press the trigger on the compression gun until it cycles and you hear a "pop". Do not pull or push on compression gun during compression.



Finished.

