



Installation instructions of N type male connector for 1/2" superflexible cable

NM-SCF12-CP01

ITEM: 2161276.1


Please read the instructions carefully before assembly.

Tools and Material:

Trimming tool, compression gun, power drill, spacer B, cable cutter, foam remover.



Assembly tools (required).

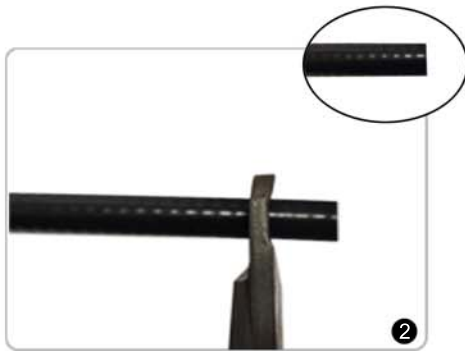


2 Straighten cable. Cut off the cable head.




3 Attach the trimming tool to power drill.



5 Insert the cable into the trimming tool. Select the low speed on the drill or 400~600 RPM on a variable speed drill. Trim the cable until no further debris generated.

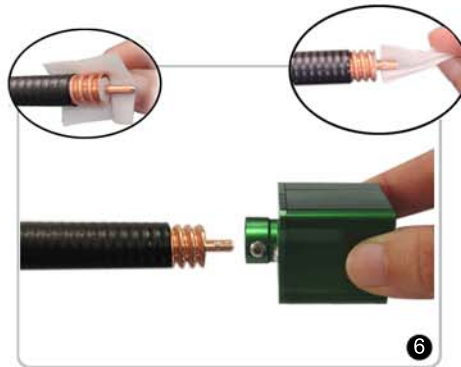


6 Use foam remover to remove any dielectric residue from the inner conductor. Clean the inner and outer conductor with alcohol pad.

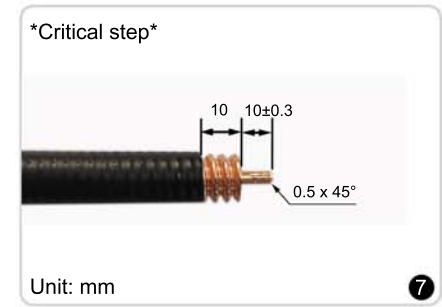

Critical step

Unit: mm

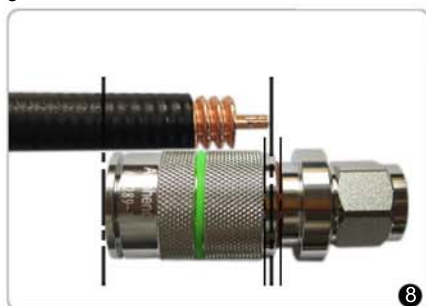

8 Align inner conductor as shown with the middle of two lines. Mark cable jacket in line with end of connector.




9 Screw the connector onto the cable until it reaches the marked line. Over tighten is forbidden.



Installation instructions of N type male connector for 1/2" superflexible cable

NM-SCF12-CP01

ITEM: 2161276.1

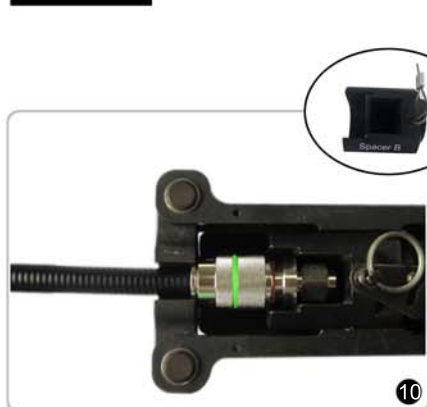

Place spacer B into the compression frame. Make sure the connector and cable both lay flat in the compression frame.



Press the trigger on the compression gun until it cycles and you hear a "pop". Do not pull or push on compression gun during compression.



Finished.